

OPERATORS MANUAL

MODELS 5400DT 5450DT

HYPOT® AND GROUND CONTINUITY TEST SET


ASSOCIATED RESEARCH, INC.
905 CARRIAGE PARK AVENUE
LAKE BLUFF, IL 60044 U.S.A.
PHONE 1 (708) 295-3312
FAX: 1 (708) 295-9165

FOR TECHNICAL ASSISTANCE
PHONE: 1 (800) 858-TEST

PART NUMBER 36769

REVISION A

MP MASTER



MA30099



TABLE OF CONTENTS

INTRODUCTION	1
SAFETY PRECAUTIONS REQUIRED FOR HIGH VOLTAGE TESTING	2
WHY PERFORM DIELECTRIC VOLTAGE-WITHSTAND TESTS	6
TYPICAL APPLICATIONS	8
FEATURES OF MODELS 5400DT AND 5450DT	10
PERFORMING CONTINUITY TESTS	16
PERFORMING MANUALLY OPERATED TESTS	17
PERFORMING TIMED TESTS	18
CURRENT TRIP POINT ADJUSTMENTS	20
REMOTE INTERFACE	22
SPECIFICATIONS	26
REPLACEMENT PARTS LIST	30

INTRODUCTION

This manual explains the need for dielectric voltage-withstand tests, the precautions necessary to ensure that the tests are done safely, and typical application guidelines for testing various classes of materials, components and products.

The manual describes the features of Associated Research Inc. Models 5400DT and 5450DT Hypots®, and gives step-by-step instructions for their proper use. Finally, technical data is presented for these models.

Associated Research, Inc. has been manufacturing High Voltage Testing Instruments since 1936. Our line of Dielectric Voltage-Withstand Testers (Hypots®) is the broadest line available today. These products are based upon designs from the early 1940's when ARI manufactured the first commercial Hypot tester for Electric Motor Division of General Motors.

These instruments have gone through several generations of design improvements, building on reliable, field proven technology and contain the features and benefits our customers have requested.

Digitized by the Internet Archive
in 2026

SAFETY PRECAUTIONS REQUIRED FOR HIGH VOLTAGE TESTING

WARNING: A Hipot produces voltages and currents which can cause harmful or fatal electric shock. To prevent accidental injury or death, these safety procedures must be strictly observed when handling and using the test instrument.

SERVICE AND MAINTENANCE

User Service

To prevent electric shock do not remove the instrument cover. There are no user serviceable parts inside. Refer servicing to an Associated Research, Inc. authorized service center. Schematics, when provided, are for reference only.

Service Interval

The instrument and its power cord, test leads, and accessories must be returned at least once a year to an Associated Research authorized service center for calibration and inspection of safety related components. Associated Research will not be held liable for injuries suffered if the instrument is not returned for its annual safety check and maintained properly.

User Modifications

Unauthorized user modifications will void your warranty. Associated Research will not be responsible for any injuries sustained due to unauthorized equipment modifications or use of parts not specified by Associated Research. Instruments returned to Associated Research with unsafe modifications will be returned to their original operating condition at your expense.

TEST STATION

Location

Select an area away from the main stream of activity which employees do not walk through in performing their normal duties. If this is not practical because of production line flow, then the area should be roped off and marked for HIGH VOLTAGE TESTING. No employees other than the test operators should be allowed inside.

If benches are placed back-to-back, be especially careful about the use of the bench opposite the test station.

Power

Dielectric Voltage-Withstand Test Equipment must be connected to a good ground. Be certain that the power wiring to the test bench is properly polarized and that the proper low resistance bonding to ground is in place.

Some testers incorporate monitor circuits which check the connections to the power line and ground. The lights on these line

monitors show at a glance if the wiring is correct or if the polarity is wrong, ground missing, etc. If the line monitor shows a fault condition, turn off and unplug the tester and do not use it until the wiring is repaired.

Power to the test station should be arranged so that it can be shut off by one prominently marked switch located at the entrance to the test area. In the event of an emergency, anyone can cut off the power before entering the test area to offer assistance.

Work Area

Perform the tests on a nonconducting table or workbench, if possible. If you cannot avoid using a conductive surface, be certain that it is securely grounded to a good earth ground and insulate the high voltage connection from the grounded surface.

There should not be any metal in the work area between the operator and the location where products being tested will be positioned. Any other metal in the work area should be connected to a good ground, never left "floating".

Position the tester so the operator does not have to reach over the product under test to activate or adjust the tester.

Keep the area clean and uncluttered. All test equipment and test leads not absolutely necessary for the test should be removed from the test bench and put away. It should be clear to both the operator and to any observers which product is being tested, and which ones are waiting to be tested or have already been tested.

Do not perform Hipot tests in a combustible atmosphere or in any area where combustible materials are present.

TEST OPERATOR

Qualifications

This instrument generates voltages and currents which can cause harmful or fatal electric shock and must only be operated by a skilled worker trained in its use.

The operator should understand the electrical fundamentals of voltage, current, and resistance. They should recognize that the test instrument is a variable high-voltage power supply with the return lead directly connected to earth ground and therefore, current from the high-voltage output will flow through any available ground path.

Safety Procedures

Operators should be thoroughly trained to follow these and all other applicable safety rules and procedures before they begin a test. Defeating any safety system should be treated as a serious offense and should result in severe penalties, such as removal from the Hipot testing job. Allowing unauthorized personnel in the area during a test should also be dealt with as a serious offense.

Dress

Operators should not wear jewelry which could accidentally complete a circuit.

Medical Restrictions

This instrument should not be operated by personnel with heart ailments or devices such as pacemakers.

TEST PROCEDURES

!NEVER PERFORM A HIPOT TEST ON ENERGIZED CIRCUITRY OR EQUIPMENT!

Connect the return (ground) lead first for any test regardless of whether the item under test is a sample of insulating material tested with electrodes, a component tested with the high voltage test lead, or a cord-connected device with a two or three prong plug.

Plug in the high voltage test lead only when it is being used. Handle its clip only by the insulator---never touch the clip directly.

Be certain that the operator has control over any remote test switches connected to the Hipot.

Before turning on the Hipot, rotate the voltage control to its maximum counterclockwise position. Double check the return (ground) and high voltage connections to be certain that they are proper and secure.

NEVER TOUCH THE ITEM UNDER TEST OR ANYTHING CONNECTED TO IT WHILE HIGH VOLTAGE IS PRESENT DURING THE HIPOT TEST.

At the end of a test, once again rotate the voltage control to its maximum counterclockwise position and check the meter to be sure the voltage across the item under test has dropped to zero before disconnecting the test leads. When testing with DC, always discharge the capacitance of the item under test and anything the high voltage may have contacted--such as test fixtures--before handling it or disconnecting the test leads.

HOT STICK probes can be used to discharge any capacitance in the item under test as a further safety precaution. A hot stick is a nonconducting rod about two feet long with a metal probe at the end which is connected to a wire. To discharge the device under test, two hot sticks are required. First connect both probe wires to a good earth ground. Then touch one probe tip to the same place the return lead was connected. While holding the first probe in place, touch the second probe tip to the same place where the high voltage lead was connected. Again, check the meter to be sure the voltage has dropped to zero.

WHY PERFORM DIELECTRIC VOLTAGE-WITHSTAND TESTS

A dielectric voltage-withstand test is a deliberate application of a higher than normal potential across some insulating material or the entire insulation system of a component or device. This stresses the insulation and the intent is to verify that the insulation can withstand this stress without breaking down (arcing) and without drawing excessive leakage current.

If the insulation passes this test, it is assumed that it will withstand the lesser stress of its intended application. The test can uncover defects in material or workmanship which would render the insulation system ineffective if not corrected and could result in a potentially unsafe product.

The items are most commonly subjected to dielectric voltage-withstand tests fall into four categories:

1. Insulating raw materials: solids, liquids, gases.
2. Components: switches, relays, transformers, circuit breakers, potentiometers, wire cable, connectors, etc.
3. End Products: appliances, motors, instruments, office machines, medical equipment, power tools, etc.
4. Repaired or rebuilt products: rewound motors, generators, and transformers; repaired appliances, etc.

The tests performed on these items can usually be grouped into one of the following classes:

1. Design Tests: A manufacturer can conduct laboratory tests to check the insulation designed into his product or purchased from an outside supplier. These tests measure the dielectric properties of the material when subjected to the high voltage conditions specified by the manufacturer or supplier. These tests can also gauge the relative insulating quality of competing products during component selection.
2. Routine Production Tests: A manufacturer can conduct tests at various points in the production of his products to uncover defects in material or workmanship and take corrective action before the defective product receives further processing. Regulatory agencies or independent testing labs will often require specific tests on completed products immediately prior to packaging for shipment. The products must pass these tests as a condition for "listing" or "recognition" or "certification" or even for permission to offer the product for sale.

3. Acceptance Tests: A buyer can conduct tests on purchased components to prove that they meet minimum insulation specifications to prevent faulty components from being incorporated into their products.
4. Service or Maintenance Tests: Maintenance personnel responsible for electrical machinery and tools can hipot test their equipment to check the integrity of its insulation system. Periodic testing reveals whether or not deterioration has taken place and its extent.

Service companies which rebuild motors or fix appliances perform a hipot test after repairing equipment as a safety check to verify that they have done the work properly and have not degraded the product's insulation system.

TYPICAL APPLICATIONS

To insure that the insulation or insulation system is properly stressed during a dielectric voltage-withstand test, the voltage must be applied across the insulation. This is NOT the same connection as is normally used to power up the device being tested.

The voltage used and the time for which it is applied are usually specified by the manufacturer of an insulating material or by a regulatory or testing agency. When they are not, the test is often performed for 60 seconds at twice the normal operating voltage, plus 1000 volts. For example, a household iron rated at 120V would normally be tested at 1240V for one minute.

Application of the test voltage to the items most commonly subjected to a dielectric voltage-withstand test is discussed below:

1. Insulating raw materials: The test voltage is applied to the test sample by placing the sample between two metallic electrodes connected to the Hipot output. The size and shape of the electrodes must be proper for the type and amount of material being tested. For testing liquids or gases, suitable containers must also be used. For fixturing information, refer to the individual test specifications for the material to be tested.
2. Components: The test voltage is applied between parts which are normally conducting and parts which are normally isolated and nonconducting or grounded. For example, in testing a potentiometer, the three potentiometer terminals would normally be shorted together and connected to the high voltage lead, and the case of the potentiometer would be connected to the return lead. Some components such as motors and transformers require additional tests between two normally conducting parts which must be insulated from each other. For example, a simple transformer would be tested primary to secondary in addition to being tested primary to core and secondary to core.

When testing transformers, it is a common practice to connect both ends of a winding to the high voltage. It is not the continuity of the winding which is being tested, but the insulation from every part of the winding to other components of the transformer. A similar technique is used to test any winding, coil or heating element in a component, because overstressing these parts is not generally part of the Hipot test.

Switches and relays are tested from contacts to insulation and across open contacts. A special electrode may be required to


test the insulation of resistors, capacitors and similar items encapsulated by a coating or molded case. The special electrode, touching the outside of the coating or case, is one connection point. The other is the device leads, all shorted together.

3. End products: These are typically line-cord connected finished products. The double-insulated variety must be tested with special electrodes touching the outside of the case connected to the return (ground) lead of the Hipot and BOTH blades of the line cord connected to the high voltage lead of the Hipot. Any device with metal parts on its exterior should have the return (ground) lead connected to those metal parts (all connected together at once, or sequentially) and the high voltage applied to BOTH blades of the line cord.

When testing cord-connected end products, always leave the power switch on so that the entire line circuit will be tested. If the device does not have a neutral connection, and the ground connection normally carries a current, it will fail a Hipot test from line to ground unless the connection from the internal wiring to ground is temporarily lifted during the test. Combination 115-230V appliances are often of this nature.

4. Repaired or rebuilt products: The same techniques are generally used as on new equipment, except that the test voltage or time is sometimes reduced.

FEATURES OF MODELS 5400DT AND 5450DT

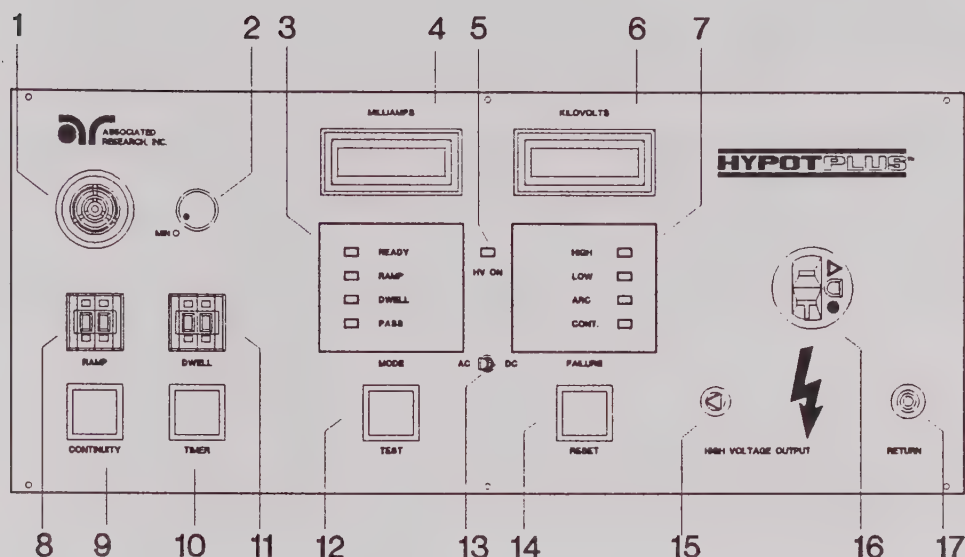

FRONT PANEL FEATURES

1. Alarm sounds to alert the operator when a failure has occurred. Press the Reset Switch to clear the failure and turn off the alarm.
2. Voltage Adjust Knob. This control varies the high voltage output from near zero (MIN position) to the rated output potential (maximum clockwise position).

To adjust the voltage, the Test switch must be pressed. Therefore, if the setting is unknown, check it on the KV meter with the test leads disconnected or adjust the knob to MIN before pressing the Test switch.

3. The MODE indicators display the hipot's operating status as it steps through the test sequence.
- 3a. Ready Indicator. This indicator shows when the hipot is ready to perform the next test. With the Continuity switch in the OFF position, the Ready indicator is normally lit immediately after turning on the Power switch or after pressing the Reset switch. With the Continuity switch in the ON position, the Ready indicator is lit when continuity exists between the chassis ground pin of a three-wire line cord and the exposed

metal on the device under test. The Ready indicator turns off while a test is in process.

- 3b. Ramp Indicator. This indicator is lit when the hipot is in RAMP mode. In this mode, the high voltage output will linearly increase to its preset test level during the interval programmed into the ramp time select switch.
- 3c. Dwell Indicator. This indicator is lit when the hipot is in DWELL mode. In this mode, the hipot maintains the high voltage output at the preset test level for the interval programmed into the dwell time select switch.
- 3d. Pass Indicator. This indicator lights at the end of the hipot test if no failure has occurred during the test.
- 4. Digital Milliammeter. $3\frac{1}{2}$ digits with 1% accuracy, ± 1 Least Significant Digit.
- 5. High Voltage On Indicator. This indicator flashes on and off when the Test Switch is pressed to warn the operator that high voltage is present at the high voltage output jack and the high voltage output receptacle.
- 6. Digital Kilovolt Meter. $3\frac{1}{2}$ digits with 1% accuracy, ± 1 Least Significant Digit.
- 7. Fail Indicators. When a failure occurs during a hipot test, these indicators tell the operator what kind of failure was detected.
- 7a. High Fail Indicator. This indicator lights when the actual leakage current exceeds the High Current Trip Point.
- 7b. Low Fail Indicator. This indicator lights when the actual leakage current falls below the Low Current Trip Point.
- 7c. Arc Fail Indicator. This indicator lights when an arc breakdown is detected.
- 7d. Continuity Fail Indicator. This indicator lights if the hipot senses greater than 1 ohm resistance between the safety ground pin of a three-wire line cord and exposed metal on the device under test where the return lead is connected.

The Continuity Test Switch must be in the ON position to enable continuity failure detection.

8. Ramp Time Select Switch. When a timed test is selected, this switch varies the ramp time from 0 to 99 seconds in 1 second intervals. Pressing the button just below the number increases the time interval. Likewise, pressing the button just above the number decreases the time interval. To insure accurate timing, do not change the switch setting while a test is in process.
9. Continuity Test On-Off Switch. This alternate action switch enables continuity testing in the ON position. The switch is ON when the yellow button is pushed in and the lamp is lit.

When testing devices with a three-wire line cord, this switch should ON. Continuity testing procedures are explained on page 16.


10. Timer On-Off Switch. This alternate action switch selects Timed Testing in the ON position and Manual Testing in the OFF position. The switch is ON when the white button is pushed in and the lamp is lit.

The Ramp and Dwell Timers are enabled with the switch in the ON position. Manual test procedures are explained on page 17 and Timed test procedures are explained on page 18.

11. Dwell Time Select Switch. When a timed test is selected, this switch varies the dwell time from 0 to 99 seconds in 1 second intervals. Pressing the button just below the number increases the time interval. Likewise, pressing the button just above the number decreases the time interval. To insure accurate timing, do not change the switch setting while a test is in process.
12. Test Switch. This is a momentary contact switch. Press the green button to turn on the high voltage output. For Manual tests, press and hold the switch. For Timed tests, press and release the switch.
13. AC/DC Selection Switch (Model 5450DT only). This is an alternate action switch to select AC or DC testing. The switch setting should not be changed while a test is in process.
14. Failure Indicator and Reset Switch. This is a lamp combined with a momentary contact switch. If excessive ground resistance, out-of-range leakage current, or an arc breakdown is detected during the hipot test, the red Failure lamp will light. To reset the system for the next test, press and release the red Reset button.

NOTE: Pressing the Reset Switch will terminate any test in process.

15. Detachable 5 foot (1.52 m) High Voltage Lead for testing devices without a line cord. The silicone rubber insulation is flexible for easy handling and is rated at 30KVDC. The jack is recessed for safety when this lead is not in use.
16. Receptacle for Testing Cord-connected Devices. The line and neutral terminals of this receptacle are BOTH connected to the high voltage output. The ground terminal is isolated from ground if the Continuity Test switch is ON, and connected to ground if the Continuity Test switch is OFF.
17. Detachable 5 foot (1.52 m) Return (ground) Lead. This lead is always used in making a test. It is grounded for safety during the test. When testing a device with a three-wire cord, continuity is measured between the device's chassis ground pin and the return lead.

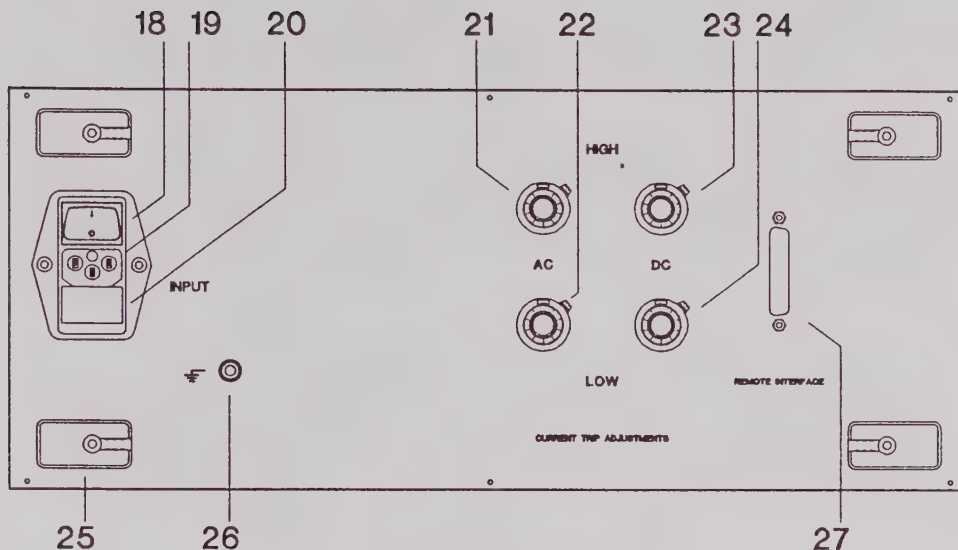

REAR PANEL FEATURES

18. **Power Switch.** Rocker-style switch with international ON (1) and OFF (0) markings.
19. **Standard IEC 320 connector** with detachable 7½ foot (2.29 m) power cord.
20. **Line fuse and voltage changer** integrated with power connector. To change the fuse unplug power cord and insert a screwdriver into the slot to slide open fuse the compartment.

Line voltage selection is set by the position of the fuse compartment. For 110-120V operation align the 110V arrow on the fuse compartment with the arrow on the body of the power module and slide it into place.

For 220-240V operation align the 220V arrow on the fuse compartment with the arrow on the body of the power module and slide it into place.

21. **AC High Current Trip Adjustment.** This control sets the AC HIGH trip point from .25 to 20 mA. If the leakage current of the device under test exceeds this setting, the HIGH FAIL alarm will trip. Turn the control counterclockwise to lower the trip point and clockwise to raise the trip point.

22. AC Low Current Trip Adjustment. This control sets the AC LOW trip point from .1 to 10 mA. If the leakage current of the device under test is less than this setting, the LOW FAIL alarm will trip. Turn the control counterclockwise to lower the trip point and clockwise to raise the trip point.
23. DC High Current Trip Adjustment (Model 5450DT only). This control sets the DC HIGH trip point from .25 to 5 mA. If the leakage current of the device under test exceeds this setting, the HIGH FAIL alarm will trip. Turn the control counterclockwise to lower the trip point and clockwise to raise the trip point.
24. DC Low Current Trip Adjustment (Model 5450DT only). This control sets the DC LOW trip point from .1 to 5 mA. If the leakage current of the device under test is less than this setting, the LOW FAIL alarm will trip. Turn the control counterclockwise to lower the trip point and clockwise to raise the trip point.
25. Cord Wrap for line cord storage. Plug inserts into center slot.
26. Chassis Ground Terminal will accept banana plug, spade lug, or stripped wire connection. This terminal should be connected to a good earth ground before using the test instrument.
27. The Remote Interface provides a convenient way to connect the hipot to an automatic test system. The interface connector is an industry standard 25-pin "D" subminiature female receptacle. See page 22 for a complete description of the remote interface connector signals and guidelines for connection to an automatic test system.

PERFORMING CONTINUITY TESTS

Continuity testing is done to insure that a low resistance path exists between the safety ground pin of a three-wire line cord and exposed metal of the item under test.

If a live wire inside the item under test came loose and contacted the chassis, the fault current would flow through the low resistance safety ground, protecting the user.

When testing equipment with three-wire line cords follow the steps below:

1. Set the Continuity Switch to the ON position with the yellow lens lit.
2. Connect the return lead from the tester to exposed metal on the chassis of the item under test.
3. Plug the three-wire line cord into the high voltage receptacle.
4. If continuity is GOOD (1 ohm or less), the Ready indicator will light. Proceed with the hipot test by pressing the Test Switch.

Continuity is continuously monitored during the hipot test. If continuity is lost while the test is in process, the high voltage will shut off, the Continuity Fail and Red Failure Indicators will light, and the audio alarm will sound. Press the Reset Switch to clear the failure and reset the system for the next test.

5. If continuity is BAD (greater than 1 ohm), the Ready indicator will not light. Pressing the Test Switch will not apply high voltage, the Continuity Fail and Red Failure Indicators will light, and the audio alarm will sound. Press the Reset Switch to clear the failure and reset the system for the next test.

PERFORMING MANUALLY OPERATED TESTS

CAUTION: To insure operator safety, review and follow the Safety Precautions for High Voltage Testing at the beginning of this manual before performing any high voltage tests.

1. Locate the Hypot® in an isolated area where adequate light and power are available. Allow enough room around the device to be tested to make straightforward and uncrowded connections and to insure that all personnel will be able to stay clear during the tests.

The table or bench should be nonconducting. If a conductive surface must be used, it should be securely grounded to a good earth ground, and the high voltage connection must be insulated from ground.

2. Be sure the power switch is OFF. Install and connect the line cord and turn the Power switch ON.
3. Connect the return lead to the Hypot® and to the item to be tested. If testing with the high voltage lead, connect it to the Hypot® and to the item under test. If testing a cord-connected item, plug it into the high voltage receptacle and set the Continuity Test switch to ON for a three-wire line cord or OFF for a two-wire line cord or other device.
4. Place the Timer Switch into the OFF position. Rotate the voltage control fully counterclockwise. Press and hold the Test switch and rotate the voltage control clockwise while observing the output voltage on the KV meter. When the meter reads the desired test voltage, start timing the test. Hold the switch for the duration of the test interval and then release the switch.

NEVER TOUCH THE ITEM UNDER TEST OR ANYTHING CONNECTED TO IT WHILE HIGH VOLTAGE IS PRESENT DURING THE HIPOT TEST.

If no failure occurs during the test interval, the item has passed the hipot test. If excessive ground resistance, out-of-range leakage current, or an arc breakdown is detected during the hipot test, the high voltage will shut off, the Failure indicators will light and the audio alarm will sound. To reset the system for the next test, press and release the Reset switch.

5. Verify that high voltage has dropped to zero by observing the kilovolt meter. The item tested can then be disconnected and the next item connected for testing.

PERFORMING TIMED TESTS

CAUTION: To insure operator safety, review and follow the Safety Precautions for High Voltage Testing at the beginning of this manual before performing any high voltage tests.

1. Locate the Hypot® in an isolated area where adequate light and power are available. Allow enough room around the device to be tested to make straightforward and uncrowded connections and to insure that all personnel will be able to stay clear during the tests.

The table or bench should be nonconducting. If a conductive surface must be used, it should be securely grounded to a good earth ground, and the high voltage connection must be insulated from ground.

2. Be sure the power switch is OFF. Install and connect the line cord and turn the Power switch ON.
3. Connect the return lead to the Hypot® and to the item to be tested. If testing with the high voltage lead, connect it to the Hypot® and to the item under test. If testing a cord-connected item, plug it into the high voltage receptacle and set the Continuity Test switch to ON for a three-wire line cord or OFF for a two-wire line cord or other device.
4. Place the Timer Switch into the OFF position. Rotate the voltage control fully counterclockwise. Press and hold the Test switch and rotate the voltage control clockwise while observing the output voltage on the KV meter. When the meter reads the desired test voltage, release the switch.

NEVER TOUCH THE ITEM UNDER TEST OR ANYTHING CONNECTED TO IT WHILE HIGH VOLTAGE IS PRESENT DURING THE HIPOT TEST.

If the test voltage can be applied all at once, then the Ramp timer should be set to 00. If the voltage must be applied gradually, the Ramp Timer should be set for the desired ramp up interval.

5. Place the Timer Switch in the ON position. Set the test interval with the Ramp Time and Dwell Time Select Switches.
6. Press and release the Test switch. During the Ramp time, the high voltage will uniformly increase to the level set in Step 4 and remain at this level for the duration of the Dwell Time.

If no failure occurs during the test interval, the item has passed the hipot test. If excessive ground resistance, out-

of-range leakage current, or an arc breakdown is detected during the hipot test, the high voltage will shut off, the Failure indicators will illuminate and the audio alarm will sound. To reset the system for the next test, press and release the Reset switch.

7. Verify that high voltage has dropped to zero by observing the kilovolt meter. The item tested can then be disconnected and the next item connected for testing.

CURRENT TRIP POINT ADJUSTMENTS

The HIGH CURRENT trip point sets the upper limit for the actual leakage current of the Device Under Test (DUT). Likewise, the LOW CURRENT trip point sets the lower limit for the DUT leakage current.

If the actual leakage current from the DUT is between these limits, the DUT passes the hipot test. If the DUT leakage current is outside these limits, the high voltage will shut off, the fail indicator will light and the alarm will sound.

If the actual leakage current exceeds the high current trip point the HIGH FAIL indicator will light; likewise, if the actual leakage current is less than the low current trip point the LOW FAIL indicator will light.

The high and low current trip points are preset to 5 ma and .5 ma respectively. If these settings are not appropriate for your application, they can be reset as follows.

Preliminary Settings

When setting the high and low trip points for the first time, disengage the shaft locks, rotate the High Trip Point control to its maximum clockwise (CW) position, and rotate the Low Trip Point control to its maximum counterclockwise (CCW) position.

Connect a test load across the high voltage output and return leads. The test load should be a value in the 120K to 2M impedance range which approximates the load of the DUT.

Rotate the voltage control to its maximum counterclockwise position (minimum output).

Set the Dwell Timer for 99 seconds and place the timer select switch in the ON position.

High Trip Point Adjustment

Push and release Test Switch and raise the voltage until the current as shown on the milliammeter reaches the desired high limit value.

Rotate the High Trip Point control counterclockwise until the High Fail alarm trips.

To clear the failure, press and release the Reset Switch.

To verify the setting, rotate the voltage control counterclockwise to slightly reduce the voltage. Push and release the test switch

and slowly raise the voltage while monitoring the current. When the current just reaches the set point, the High Fail alarm should trip.

If the alarm trips with the current too low or too high, adjust the High Trip Point control slightly CW or CCW and reverify the setting.

When the adjustment is set, engage the shaft lock to hold the setting in place.

Low Trip Point Adjustment

Push and release Test Switch and raise the voltage until the current as shown on the milliammeter reaches the desired low limit value.

Rotate the Low Trip Point control CW until the Low Fail alarm trips.

To clear the failure, press and release the Reset Switch.

To verify the setting, rotate the voltage control CW to slightly increase the voltage. Push and release the test switch and slowly lower the voltage while monitoring the current. When the current just reaches the set point, the Low Fail alarm should trip.

If the alarm trips with the current too low or too high, adjust the Low Trip Point control slightly CW or CCW and reverify the setting.

When the adjustment is set, engage the shaft lock to hold the setting in place.

Turn off the Dwell Timer and restore the Dwell Time to its original setting.

REMOTE INTERFACE

The remote interface provides the user with a convenient way to connect the hipot to a wide variety of test equipment ranging from a simple footswitch for hands-free test initiation to a complex computer-based automatic test system for statistical process control.

Through the remote interface, the test system can start and stop the hipot test, set the voltage applied to the item under test, measure the actual test voltage and leakage current during the test, and monitor fault conditions which may occur while the test is in process.

Each of the interface functions is described below, followed by a table showing the signals assigned to each contact of the interface connector.

Input Switches

Three user-provided switches can be connected to the hipot. Either a dry-closure relay contact or an optically-isolated open collector transistor can be used. The transistor must be capable of sinking 1 ma at .2VDC with 5VDC collector-emitter breakdown.

TEST SWITCH: Closing the Test switch initiates a test. If the hipot is set to manual mode the test will continue until a failure is detected or the switch is opened, whichever occurs first.

If the hipot is set to timed mode, the test will continue until a failure is detected or the ramp and dwell cycle times expire, whichever occurs first. If the Test switch stays closed at the end of a timed test, the next test cannot begin until the Test switch is first opened.

The Timer switch on the front panel is in the OFF position for manual mode or in the ON position for timed mode.

RESET SWITCH: Closing the Reset switch terminates any test in process and turns off the failure alarm, front panel failure indicators, and remote failure relays. The hipot remains in the reset state until the Reset switch is released.

SELECT SWITCH: Closing the Select switch disables the voltage control on the front panel and enables the test voltage to be set from an external DC voltage source connected to the Remote Set inputs.

Output Relays

Six relays monitor and report the results of the hipot test. The relays have normally open contacts rated for 24VAC, .25A.

TEST IN PROCESS: The Test in Process relay closes at the start of a test, remains closed during the entire test cycle, and opens when the test cycle ends. The Test in Process relay closes 25 msec. before the high voltage output is energized.

PASS: The Pass relay closes if the item under test passes the hipot test. The relay remains closed until another test is started with the Test switch or until the Reset switch is closed.

HIGH FAIL: The High Fail relay closes if the actual leakage current exceeds the High Current Trip Point during the hipot test. The relay stays closed until the Reset switch is closed.

LOW FAIL: The Low Fail relay closes if the actual leakage current falls below the Low Current Trip Point during the hipot test. The relay stays closed until the Reset switch is closed.

ARC FAIL: The Arc Fail relay closes if a flashover or breakdown is detected during the hipot test. The relay stays closed until the Reset switch is closed.

CONTINUITY FAIL: The Continuity Fail relay closes if the hipot senses greater than 1 ohm resistance between the safety ground pin of a three-wire line cord and exposed metal on the item under test where the return lead is connected. The relay stays closed until the Reset switch is closed.

The Continuity switch on the front panel must be in the ON position to enable continuity failure detection.

Remote Voltage Set

When the Select switch is closed, the high voltage output is controlled by the voltage applied to the Remote Voltage Set inputs. A 0 to 10VDC input voltage will set the high voltage output from near zero to its maximum output level.

Remote Meter Outputs

The remote meter outputs generate a DC voltage proportional to the actual test voltage and leakage current present at the item under test. These outputs are useful for monitoring actual test conditions in a computer-controlled test system. These outputs are floating relative to the hipot chassis. The input resistance of the measuring device (multimeter, analog-to-digital converter, etc) should be at least 100K.

KILOVOLT METER: These outputs generate a DC voltage proportional to the high voltage output. The scale factor is .50 VDC = 1 KV with a maximum output of 10 VDC = 20 KV.

MILLIAMP METER: These outputs generate a DC voltage proportional to the leakage current. The scale factor is .50 VDC = 1 mA. with a maximum output of 10 VDC = 20 mA.

Interface Connector

The interface connector is an industry standard 25-pin "D" subminiature female connector. The signal assigned to each contact of the interface connector is shown in table below:

<u>#</u>	<u>FUNCTION</u>	<u>DESCRIPTION</u>
1	Test Switch +	Switch input, signal
14	Test Switch -	Switch input, reference
2	Reset Switch +	Switch input, signal
15	Reset Switch -	Switch input, reference
3	Test in Process C	Relay output, common
16	Test in Process NO	Relay output, normally open
4	Pass C	Relay output, common
17	Pass NO	Relay output, normally open
5	High Fail C	Relay output, common
18	High Fail NO	Relay output, normally open
6	Low Fail C	Relay output, common
19	Low Fail NO	Relay output, normally open
7	Arc Fail C	Relay output, common
20	Arc Fail NO	Relay output, normally open
8	Continuity Fail C	Relay output, common
21	Continuity Fail NO	Relay output, normally open
9	Select Switch +	Switch input, signal
22	Select Switch -	Switch input, reference
10	Remote Voltage Set +	Input voltage, positive
23	Remote Voltage Set -	Input voltage, negative
11	Kilovolt Meter +	Output voltage, positive
24	Kilovolt Meter -	Output voltage, negative
12	Milliamp Meter +	Output voltage, positive
25	Milliamp Meter -	Output voltage, negative
13	No connection	

Mating Connector:

The interface connector mates with a 25-pin "D" subminiature male connector provided by the user. For maximum noise immunity the mating connector should have a metallic shell and cable clamp. Suggested AMP part numbers are shown below; equivalent parts may be substituted.

207464-2 PLUG SHELL WITH GROUND INDENTS
755254-7 CRIMP SNAP-IN PIN CONTACT
745173-1 SHIELDED CABLE CLAMP
747784-3 JACKSCREWS (SET OF 2)

Interface Cable:

For maximum noise immunity, use #24AWG twisted pair cable with an overall foil shield and drain wire to interconnect the hipot remote interface and the remote controller. TO AVOID GROUND LOOPS, THE SHIELD SHOULD NOT BE CONNECTED TO GROUND AT BOTH ENDS OF THE CABLE. The preferred place to ground the cable shield is at the remote controller. If this is not possible, then ground the shield to the connector shell at the hipot. The maximum length for the interface cable is 100 feet.

The suggested 25-conductor interface cable is shown below; equivalent cable may be substituted.

CABLE TYPE:	BELDEN 9684
TWISTED PAIRS:	12 $\frac{1}{2}$
WIRE GAGE:	24AWG
CHARACTERISTIC IMPEDANCE:	100 OHMS
NOMINAL DC RESISTANCE:	24 OHMS/1000 FT
NOMINAL CAPACITANCE:	15.5 PF/FT
NOMINAL O.D.:	.508 IN

SPECIFICATIONS

MODEL	5400DT
DESCRIPTION	AC Hypot® and Ground Continuity Test Set
PRIMARY APPLICATION	Manufacturing and production line testing of commercial and consumer products to meet UL, CSA, and other safety agency requirements where dielectric voltage-withstand and ground continuity tests are specified.
INPUT	100-130VAC, 50/60Hz, Single phase, 1.0A Max. 200-260VAC, 50/60Hz, Single phase, .5A Max. User selectable.
FUSE	1.6A 250V SLO BLO 5 x 20 mm (Buss GDC-1.6A)
OUTPUT VOLTAGE	0-4KVAC, Continuously adjustable. Zero-crossing turn-on. No transients exceeding 105% of peak value. 1% regulation over line input range and 120K to 2M load.
OUTPUT CURRENT	0-20mA
HIGH TRIP CURRENT RANGE	.25-20mA adjustable with multiturn pot. Factory set to 5ma.
LOW TRIP CURRENT RANGE	.1-10mA adjustable with multiturn pot. Factory set to 0.0ma.
CONTINUITY TRIP	1 ohm maximum at .1A.
FAILURE DETECTOR	Audible and visual
RAMP TIMER	0-99 Seconds in 1 second increments
DWELL TIMER	0-99 Seconds in 1 second increments
KILOVOLT METER	0-19.99 digital. 1% accuracy ± 1 Least Significant Digit.
MILLIAMPER METER	0-19.99 digital. 1% accuracy ± 1 Least Significant Digit.
SIZE (W X H X D)	17 X 7.5 X 14.5 inches.
WEIGHT	23 pounds.

SPECIFICATIONS

MODEL	5450DT
DESCRIPTION	AC/DC Hypot® and Ground Continuity Test Set
PRIMARY APPLICATION	Manufacturing and production line testing of commercial and consumer products to meet UL, CSA, and other safety agency requirements where dielectric voltage-withstand and ground continuity tests are specified.
INPUT	100-130VAC, 50/60Hz, Single phase, 1.0A Max. 200-260VAC, 50/60Hz, Single phase, .5A Max. User selectable.
FUSE	1.6A 250V SLO BLO 5 x 20 mm (Buss GDC-1.6A)
OUTPUT VOLTAGE	0-4KVAC, 0-5KVDC continuously adjustable. Zero-crossing turn-on. No transients exceeding 105% of peak value. 1% regulation over line input range and 120K to 2M load.
OUTPUT CURRENT	0-20mA AC, 0-5mA DC
HIGH TRIP CURRENT RANGE	.25-20mA AC, .25-5mA DC adjustable with multi-turn pot. Factory set to 5ma AC, 1mA DC.
LOW TRIP CURRENT RANGE	.1-10mA AC, .1-5mA DC adjustable with multi-turn pot. Factory set to 0.0ma AC and DC.
CONTINUITY TRIP	1 ohm maximum at .1A.
FAILURE DETECTOR	Audible and visual
RAMP TIMER	0-99 Seconds in 1 second increments
DWELL TIMER	0-99 Seconds in 1 second increments
KILOVOLT METER	0-19.99 digital. 1% accuracy ± 1 Least Significant Digit.
MILLIAMP METER	0-19.99 digital. 1% accuracy ± 1 Least Significant Digit.
SIZE (W X H X D)	17 X 7.5 X 14.5 inches.
WEIGHT	25 pounds.

INDEX

Acceptance Tests	7
Appliances	6, 7, 9
Breakdown	11, 12, 17, 19, 22, 23
Calibration	2
Components	1, 2, 6-8
Continuity	1, 8, 10-13, 16-18, 23, 24, 26, 27
Continuity Test	1, 11-13, 17, 18, 26, 27
Current Trip Point	11, 20, 23
Design Tests	6
Dielectric Voltage-Withstand Tests	1, 6
Dress	4
Dwell	11, 12, 18, 20-22, 26, 27
End Products	6, 9
Failure	10-12, 16, 17, 19-23, 26, 27
Failure Detector	26, 27
Failure indicator	12
Features	1, 10, 14
Ground	1-5, 9, 11-13, 15-19, 23, 25-27
High Voltage Lead	5, 8, 9, 13, 17, 18
Hipot Test	4, 7-9, 11, 12, 16-20, 22, 23
Hot Stick	5
Insulating raw materials	6
Insulation	6-9, 13
Leakage Current	6, 11, 12, 14, 15, 17, 19, 20, 22-24
Line Cord	9, 11-13, 15-18, 23
Line Monitor	3
Manual Tests	12
Medical Restrictions	4
Motors	1, 6-8
Power	2, 3, 6, 8-10, 14, 17, 18
Production Tests	6
Ramp	11, 12, 18, 22, 26, 27
Receptacle	11, 13, 15-18
Relays	9
Remote Interface	15, 22, 25
Repaired or Rebuilt Products	6, 9
Reset Switch	10, 12, 13, 16, 17, 19-24
Return Lead	3, 5, 8, 11, 13, 16-18, 23
Safety Precautions	2, 17, 18
Service and Maintenance	2
Service Interval	2
Service or Maintenance Tests	7
Specifications	7, 8, 26, 27
Switches	4, 6, 9, 18, 22
Test Operator	3
Test Procedures	4, 12
Test Station	2, 3
Test Switch	10-13, 16-18, 20-24
Timed Tests	12, 18

Transformers	6, 8
Trip Current	26, 27
User Modifications	2
User Service	2
Work Area	3

REPLACEMENT PARTS LIST

To order replacement parts, refer to the Replacement Parts List on the following pages. If you need assistance, call our Technical Support Hotline 1-800-858-TEST.

ASSOCIATED RESEARCH INC.	REPLACEMENT PARTS LIST			REVISION	E
				ECO	4436
	MODEL	SERIAL #		DATE	10-01-91
	5400DT	121	TO DATE	PAGE	1 OF 13
	5450DT	138	TO DATE		

<u>SYM</u>	<u>PART #</u>	<u>DESCRIPTION</u>	<u>QTY</u>
------------	---------------	--------------------	------------

5400DT AC HYPOT® PLUS / 5450DT AC/DC HYPOT® PLUS

04040A-08	CABLE ASSY HV	1
02100A-13	CABLE ASSY RETURN	1
33189	CABLE INPUT CORDSET USA BLK 7.5F	1

5400DT-01 / 5450DT-01 FINAL ASSY

PS801	36722	POWER SUPPLY, LOW VOLTAGE	1
	36405	KNOB BLACK PLASTIC .71 OD	1
T801	36777	TRANSFORMER HV 5000V 20MA	1
J801	35471	CONNECTOR FEMALE 3 NO. 20	1
FOR J801	35479	COVER CONNECTOR 3 CIRCUIT	1
J804,805	05400DT-18	HARNESS ASSY POWER SUPPLY	1

5400DT-02 / 5450DT-02 PANEL ASSY CONTROL

C604	15575	CAPACITOR HV .1MFD 600V	1
D600-603	36364	DIODE LED GREEN RECTANGULAR	4
D604-608	36362	DIODE LED RED RECTANGULAR	5
J604	04040AT-32	JACK FEMALE HV ASSY	1
J604	35466	RECEPTACLE HV	1
J605	05400DT-11	HARNESS ASSY RETURN	1
J611	05400DT-09	HARNESS ASSY PANEL CONTROL	1
I600,602,603	35467	LAMP INCANDESCENT 6.3	3
I604	36623	ALARM	1
M601,602	36755	METER DIGITAL 2V FS	2
R602	35664	RESISTOR VARIABLE 5K 2W 10%	1
S600,601	35449	SWITCH SPDT PUSH BUTTON MOMENTARY	2
FOR S600	35451	LENS RED SQUARE	1
FOR S601	35453	LENS LIGHT GREEN SQUARE	1
S602,603	35450	SWITCH DPDT PB ALT.	2
FOR S602	36624	PUSHBUTTON LENS SQUARE WHITE	1
FOR S603	35452	LENS YELLOW SQUARE	1
S604,605	05400DT-13	SWITCH ASSY THUMBWHEEL	2

ASSOCIATED RESEARCH INC.	REPLACEMENT PARTS LIST				REVISION	E
					ECO	4436
	MODEL	SERIAL #			DATE	10-01-91
	5400DT	121	TO	DATE	PAGE	2 OF 13
	5450DT	138	TO	DATE		

<u>SYM</u>	<u>PART #</u>	<u>DESCRIPTION</u>	<u>QTY</u>
S606*	36893	SWITCH WITH FLATTED HANDLE	1
* USED ON 5450DT ONLY			

5400DT-03 / 5450DT-03 PANEL ASSY REAR

	05400DT-12	HARNESS ASSY GROUND	1
P701	05400DT-17	MODULE ASSY INPUT	1
	05400DT-23	HARNESS ASSY LEAKAGE SETPOINT	1
J703	36764	CONNECTOR 7 CIRCUIT	1
FOR J703	35892	COVER CONNECTOR 7 CKT	1
J704	35471	CONNECTOR 3 CIRCUIT	1
FOR J704	35479	COVER CONNECTOR 3 CIRCUIT	1
	36637	CORD WRAP	4
J706	36627	TERMINAL POST GROUND	1
J707	35665	CONNECTOR, 10 POS	1
R731,732	36629	RESISTOR VARIABLE 10K 10 TURNS	2
FOR R731,732	36628	DIAL TURNS-COUNTING	2
R733,734*	36629	RESISTOR VARIABLE 10K 10 TURNS	2
FOR R733,734*	36628	DIAL TURNS-COUNTING	2
	36772	PLUG SNAP FOR.375 HOLE DIA	2
* USED ON 5450DT ONLY			

5400DT-04 PCB ASSY MOTHER BOARD

C2,4-7,9,11,13	36673	CAPACITOR .1MFD 50V CERAMIC	8
C8,12	18427	CAPACITOR ELECTROLYTIC 1MFD 50V RD	2
C10	34514	CAPACITOR ELECTROLYTIC 10MFD 16V	1
D1-4	34513	DIODE SIL 75PIV 10MA 1N4148	4
D5-10	34933	DIODE SIL 1000PIV 1A 1N4007	6
K1-6	35435	RELAY REED SPST SIP 5	6
P1-3	36779	CONNECTOR MALE 80 PIN PCB MOUNT.	3
P4,5	36762	TERMINAL HEADER 12 CONTACTS	2
P6	36780	CONNECTOR MALE 20 PIN SIP	1
P7	36681	CONNECTOR MALE DIP 20 POS. .1"	1
P8	36781	CONNECTOR MALE 26 PIN DIP	1

ASSOCIATED RESEARCH INC.	REPLACEMENT PARTS LIST				REVISION <u>E</u>
					ECO <u>4436</u>
	<u>MODEL</u>	<u>SERIAL #</u>			DATE <u>10-01-91</u>
	5400DT	121	TO	DATE	PAGE <u>3</u> OF <u>13</u>
	5450DT	138	TO	DATE	

<u>SYM</u>	<u>PART #</u>	<u>DESCRIPTION</u>	<u>QTY</u>
P9,10,12,14,15	35670	CONNECTOR MALE HEADER 10 CIRCUIT	5
P13	36378	CONNECTOR MALE 6 POST HDR	1
R1,4	36785	RESISTOR FIXED 10K 1/4W 1%	2
R2,3	36647	RESISTOR FIXED 33 OHM 1/4W 5%	2
R5	36654	RESISTOR FIXED 5.1K 1/4W 5%	1
R6,7	36650	RESISTOR FIXED 100 OHM 1/4W 5%	2
TP1-7	35644	TERMINAL STRIP ONE MALE HDR	7
U1	36738	IC QUAD OP AMP TL084ACN	1
U2	36782	IC VOLTAGE REFERENCE 10V	1

5400DT-05 PCB ASSY LOGIC

C100, 105,	35635	CAPACITOR POLY FILM .1MFD 100V 5%	5
C125, 127,131			
C101	36844	CAPACITOR FILM .001MF 50VDC	1
C102, 103,	36673	CAPACITOR .1MFD 50V CERAMIC	22
C106-109,111-117,			
C119-122,126			
C128-130			
C104	36902	CAPACITOR FILM .56UF 50VDC	1
C123	36753	CAPACITOR ELECTROLYTIC 22MF 16V	1
C124	34514	CAPACITOR ELEC 10MFD 16V	1
D100,101	34513	DIODE SIL 75PIV 10MA 1N4148	2
J100	36726	CONNECTOR 80 PIN FEMALE PCB MOUNT	1
R100	36985	RESISTOR VARIABLE 5MEG 1/4W 10%	1
R101	36987	RESISTOR FIXED 7.5MEG 1/4W 5%	1
R118	35645	RESISTOR FIXED 9.1MEG 1/4W 5%	1
R102	18375	RESISTOR FIXED 1K 1/4W 5%	1
R103	36655	RESISTOR FIXED 6.8K 1/4W 5%	1
R104	36799	RESISTOR FIXED 1.6K 1/4W 5%	1
R105, 106	36904	RESISTOR FIXED 620K 1/4W 5%	2
R107	36647	RESISTOR FIXED 33 OHM 1/4W 5%	1
R108	36880	RESISTOR FIXED 220K 1/4W 5%	1
R109-117	35206	RESISTOR FIXED 220 OHM 1/4W 5%	9

ASSOCIATED RESEARCH INC.	REPLACEMENT PARTS LIST				REVISION	E
					ECO	4436
	MODEL	SERIAL #			DATE	10-01-91
	5400DT	121	TO	DATE	PAGE	4 OF 13
	5450DT	138	TO	DATE		

<u>SYM</u>	<u>PART #</u>	<u>DESCRIPTION</u>	<u>QTY</u>
R120	36883	RESISTOR FIXED 1.5M 1/4W 5%	1
R119	35630	RESISTOR FIXED 47K 1/4W 5%	1
RN100-104	36817	RESISTOR FIXED SIP 10K 2 %	5
TP100-111	35644	TERMINAL PIN	12
U100	35576	IC TIMER CMOS 7250	1
U101-103	35251	IC TIMER 555	3
U104-106	36605	IC DRIVER 7 CHANNEL SN75468	3
U107	05400DT-27	PROGRAMMABLE LOGIC ASSY SEQUENCER	1
U108	05400DT-26	PROGRAMMABLE LOGIC ASSY FAILLATCH	1
U110	36677	IC 75452	1
U111	36675	IC 74HC109	1
U112-115,119	36368	IC 74HC14	5
U116-118	36674	IC 74HC32	3
FOR U107,108	35724	SOCKET IC 24 PIN 0.3 CNTRS	2
<u>5400DT-06 PCB ASSY ANALOG</u>			
C300,302,	36673	CAPACITOR .1MFD 50V CERAMIC	28
C304-316,322-324,			
C329-331,337-343			
C301,303,344	18427	CAPACITOR ELECTROLYTIC 1MFD 50V	3
C317-319,	36800	CAPACITOR CERAMIC 100PF 100V 5%	5
C335,336			
C320,321,	36801	CAPACITOR FILM .047UF 100V 10%	4
C325,326			
C327,328	36753	CAPACITOR ELECTROLYTIC 22MF 16VDC	2
C332-334	36802	CAPACITOR FILM .01UF 100V 10%	3
C345	36905	CAPACITOR FILM 1UF 50V 5%	1
D300-314	34513	DIODE 75V 10MA IN4148	15
J300	36726	CONNECTOR 80 PIN FEMALE PCB MOUNT	1
R300-311,322	36647	RESISTOR FIXED 33 OHM 1/4W 5%	13
R312-314,316,	36828	RESISTOR FIXED 1.0K 1/4W 1%	7
R324,346,349			
R315,317	36795	RESISTOR FIXED 330 OHM 1/4W 5%	2

ASSOCIATED RESEARCH INC.	REPLACEMENT PARTS LIST				REVISION <u>E</u>
					ECO <u>4436</u>
	<u>MODEL</u>	<u>SERIAL #</u>			DATE <u>10-01-91</u>
	5400DT	121	TO	DATE	PAGE <u>5</u> OF <u>13</u>
	5450DT	138	TO	DATE	

<u>SYM</u>	<u>PART #</u>	<u>DESCRIPTION</u>	<u>QTY</u>
R318,319	36796	RESISTOR FIXED 240 OHM 1/4W 5%	2
R320	36654	RESISTOR FIXED 5.1K 1/4W 5%	1
R321	36885	RESISTOR FIXED 750 OHM 1/4W 5%	1
R323	35206	RESISTOR FIXED 220 OHM 1/4W 5%	1
R325	36797	RESISTOR FIXED 360 OHM 1/4W 5%	1
R326,343, R367-370	35094	RESISTOR FIXED 15K 1/4W 1%	6
R330,334	35631	RESISTOR FIXED 1M 1/4W 5%	2
R327,328	35645	RESISTOR FIXED 9.1M 1/4W 5%	2
R329	36881	RESISTOR FIXED 910 OHM 1/4W 5%	1
R331,352	36652	RESISTOR FIXED 499 OHM 1/4W 1%	2
R332,344,353	36785	RESISTOR FIXED 10K 1/4W 1%	3
R333	36799	RESISTOR FIXED 1.6K 1/4W 5%	1
R335,336	36939	RESISTOR FIXED 90.9K 1/4W 1%	2
R338	36943	RESISTOR FIXED 46.4K 1/4W 1%	1
R339,340	36940	RESISTOR FIXED 97.6K 1/4W 1%	2
R341	50206	WIRE 20AWG SOLID TINNED	1
R342	36944	RESISTOR FIXED 54.9K 1/4W 1%	1
R345	36783	RESISTOR FIXED 10 OHM 1/4W 1%	1
R347	36655	RESISTOR FIXED 6.8K 1/4W 5%	1
R348,337	36798	RESISTOR FIXED 20K 1/4W 1%	2
R350,351,365	36794	RESISTOR FIXED 2K 1/4W 1%	3
R354,360,362	36756	RESISTOR VARIABLE 1K RT ANGLE	3
R355-359,361, R363,364	36758	RESISTOR VARIABLE 10K RT. ANGLE	8
R366	36887	RESISTOR FIXED 150 OHM 1/4W 5%	1
RN300-302	36668	RESISTOR DIP PACK 1K TYPE 3	3
RN303-307	36670	RESISTOR DIP PACK 10K TYPE 3	5
Q300	34517	TRANSISTOR PNP TIP42	1
TP300-308	35644	TERMINAL STRIP ONE MALE HDR	9
U300	36984	IC QUAD OP AMP AD704	1
U301-305, 310	36738	IC QUAD OP AMP TL084ACN	6
U306, 308	36737	IC ANALOG SWITCH DUAL SPDT	2

ASSOCIATED RESEARCH INC.	REPLACEMENT PARTS LIST				REVISION <u>E</u>
	<u>MODEL</u>		<u>SERIAL #</u>		ECO <u>4436</u>
	5400DT	121	TO	DATE	DATE 10-01-91
	5450DT	138	TO	DATE	PAGE 6 OF 13

<u>SYM</u>	<u>PART #</u>	<u>DESCRIPTION</u>	<u>QTY</u>
U307	36680	IC LM339	1
U309	36368	IC 74HC14	1

5400DT-07 PCB ASSY DRIVER

C200,202-208,	36673	CAPACITOR .1MFD 50V CERAMIC	24
C211,213-218,			
C220-223,244,			
C248-251			
C201,219	36905	CAPACITOR 1UF 50V 5%	2
C209,241 242	36801	CAPACITOR FILM .047UF 100V 10%	4
C255			
C210,254	36902	CAPACITOR FILM .56UF 50VDC	2
C212	35635	CAPACITOR POLY FILM .1MFD 100V 5%	1
C224-226	36806	CAPACITOR 1.0MF 35V TANT 10%	3
C227	36805	CAPACITOR .68MF 35V TANT 10%	1
C228,229,256	36807	CAPACITOR 3.3MF 35V TANT 10%	3
C230	36808	CAPACITOR 4.7 MF 35 VOLT TANT 10%	1
C231-233,252	36810	CAPACITOR 10MF 25V TANT 10%	4
C234	36809	CAPACITOR 6.8MF 25V TANT 10%	1
C235,236,253	36811	CAPACITOR 33MF 10V TANT 10%	3
C237	36812	CAPACITOR 47MF 6V TANT 10%	1
C238,240	36800	CAPACITOR CERAMIC 100PF 100V 5%	2
C239	36844	CAPACITOR FILM .001MF 50V	1
C243	36917	CAPACITOR 270PF 100V 5%	1
C245	34514	CAPACITOR ELEC 10MFD 16V	1
C246,247	18427	CAPACITOR ELECTROLYTIC 1MFD 50V RD	2
J200	36726	CONNECTOR 80 PIN FEMALE PCB MOUNT.	1
K200	34978	RELAY REED 2PST	1
R200,201,	36758	RESISTOR VARIABLE 10K RT. ANGLE	7
R203-205,257,273			
R202,252	36244	RESISTOR VARIABLE 2MEG 1/4W 10%	2
R206	36942	RESISTOR VAR. 50K 1/4W 10% RA	1
R207	36985	RESISTOR VARIABLE 5MEG 1/4W 10%	1

ASSOCIATED RESEARCH INC.	REPLACEMENT PARTS LIST				REVISION	E
					ECO	4436
	MODEL	SERIAL #			DATE	10-01-91
	5400DT	121	TO	DATE	PAGE	7 OF 13
	5450DT	138	TO	DATE		

<u>SYM</u>	<u>PART #</u>	<u>DESCRIPTION</u>	<u>QTY</u>
R208-211, R218-221	36859	RESISTOR FIXED 12K 1/4W 5%	8
R212,215	36908	RESISTOR FIXED 1.3K 1/4W 5%	2
R213,214	36828	RESISTOR FIXED 1K 1/4W 1%	2
R216,222,226, 229,271,284,285	18375	RESISTOR FIXED 1K 1/4W 5%	7
R217	36929	RESISTOR FIXED 43K 1/4W 5%	1
R224,235,240	35632	RESISTOR FIXED 2MEG 1/4W 5%	3
R223,225,250	36666	RESISTOR FIXED 20K 1/4W 5%	3
R227	35094	RESISTOR FIXED 15K 1/4W 1%	1
R228	36909	RESISTOR FIXED 68K 1/4W 5%	1
R230,231,241, R248,251,260-262, 268,270,278	36654	RESISTOR FIXED 5.1K 1/4W 5%	11
R232	36864	RESISTOR FIXED 82K 1/4W 5%	1
R233	36795	RESISTOR FIXED 330 OHM 1/4W 5%	1
R234	36911	RESISTOR FIXED 120 OHM 1/4W 5%	1
R236,267	35631	RESISTOR FIXED 1MEG 1/4W 5%	2
R237,276,277, R280,283	36656	RESISTOR FIXED 10K 1/4W 5%	5
R238,272	36912	RESISTOR FIXED 2K 1/4W 5%	2
R239	36863	RESISTOR FIXED 62K 1/4W 5%	1
R242	36916	RESISTOR FIXED 825K 1/4W 1%	1
R243,244	36785	RESISTOR FIXED 10K 1/4W 1%	2
R245	36987	RESISTOR FIXED 7.5MEG 1/4W 5%	1
R246,247, R253-256,266	36647	RESISTOR FIXED 33 OHM 1/4W 5%	7
R249	35222	RESISTOR FIXED 680 OHM 1/4W 5%	1
R258,259,263, 264,274,281,282	36914	RESISTOR FIXED 100K 1/4W 5%	7
R265	36653	RESISTOR FIXED 3.3K 1/4W 5%	1
R269	36862	RESISTOR FIXED 75 OHM 1/4W 5%	1
R279	36915	RESISTOR FIXED 9.1K 1/4W 5%	1

ASSOCIATED RESEARCH INC.	REPLACEMENT PARTS LIST				REVISION <u>E</u>
					ECO <u>4436</u>
	MODEL	SERIAL #			DATE 10-01-91
	5400DT	121	TO	DATE	PAGE 8 OF 13
	5450DT	138	TO	DATE	

<u>SYM</u>	<u>PART #</u>	<u>DESCRIPTION</u>	<u>QTY</u>
RN200	36817	RESISTOR FIXED SIP 10K 2%	1
TP200-208	35644	TERMINAL STRIP ONE MALE HDR	9
U200,201	36816	IC LINEAR FOUR QUAD MULTIPLIER	2
U202	36813	IC OSCILLATOR VOLTAGE CONTROLLED	1
U203,216	36737	IC ANALOG SWITCH DUAL SPDT	2
U204-206	36738	IC QUAD OP AMP TL084ACN	3
U207	36814	IC 8-BIT MAGNITUDE COMPARATOR	1
U208	35576	IC TIMER CMOS 7250	1
U209,210,217	36368	IC 74HC14	3
U211	36867	IC NAND BUFFER 74LS26	1
U212,222	34519	TRANSISTOR PNP 2N3906	2
U213,214,219	36815	IC HEX BUFFER W/HV OUTPUTS	3
U215	36680	IC LM339	1
U218	36907	IC 74HC573 OCTAL TRANS LATCH	1
U220	36906	IC 74HC30 8-INPUT NAND GATE	1
U221	36674	IC 74HC32	1
U223	34518	TRANSISTOR NPN 2N3904	1

5400DT-15 PCB ASSY INDICATOR

C602,603	36673	CAPACITOR .1MFD 50V CERAMIC	2
J600-601	36773	CABLE STRIP FLAT 2"	2
J602	36774	CABLE STRIP FLAT 7"	1

5400DT-16 PCB ASSY HV POWER AMPLIFIER

L400	05400DT-29	INDUCTOR ASSY 750UH 2.5A	1
	05400DT-31	PCB ASSY GATE DRIVE	1
	05400DT-32	PCB ASSY ANALOG/PWM	1
BR400	36501	RECTIFIER BRIDGE 10A 600V	1
BR401	36842	RECTIFIER BRIDGE 1.5A 50PIV	1
C400,401	36837	CAPACITOR ELECT. 470MF 200VDC	2
C402,403	36846	CAPACITOR ELECTROLYTIC 330MF 50V	2
C404,405	36847	CAPACITOR ELECTROLYTIC 100MF 25V	2
C406,413	36845	CAPACITOR FILM 4.7MA 50V	2

ASSOCIATED RESEARCH INC.	REPLACEMENT PARTS LIST				REVISION <u>E</u>
					ECO <u>4436</u>
	<u>MODEL</u>	<u>SERIAL #</u>			DATE <u>10-01-91</u>
	5400DT	121	TO	DATE	PAGE <u>9</u> OF <u>13</u>
	5450DT	138	TO	DATE	

<u>SYM</u>	<u>PART #</u>	<u>DESCRIPTION</u>	<u>QTY</u>
C407	36840	CAPACITOR ELECT. 3900MF 6.3VDC	1
C408,410	36838	CAPACITOR CERAMIC 270PF 1KV	2
C409,412	36839	CAPACITOR FILM .0022MF 63V	2
C411	36918	CAPACITOR 4700PF	1
C414	36927	CAPACITOR FILM 0.22MF 50V 5%	1
C415,416	36801	CAPACITOR FILM .047UF 100V 10%	2
C417	36905	CAPACITOR FILM 1MF 50V	1
C418	36802	CAPACITOR FILM .01MF 100V	1
D400-403	36848	DIODE FAST RECOVERY MUR460	4
D404	34933	DIODE SIL 1000PIV 1A 1N4007	1
D405,406	36920	DIODE ZENER 200V 1N6303	2
D409,410	34513	DIODE SIL 75PIV 10MA 1N4148	2
D411	36925	DIODE ZENER 1N4740 10V 1W	1
J400	35665	CONNECTOR FEMALE POLAR SOCKET	1
FOR J400	36770	HEADER PCB 10 POS DIP	1
K400	35432	RELAY SPDT 5VDC 5A	1
P401	36754	CONNECTOR LOCKING HEADER 3 PIN	1
P402	36765	CONNECTOR 7 CIRCUIT END MALE	1
R400,401	36824	RESISTOR FIXED 22K 5W 5%	2
R402	36833	RESISTOR FIXED 34K 1/4W 1%	1
R403	35630	RESISTOR FIXED 47K 1/4W 5%	1
R404	36831	RESISTOR FIXED 47 OHM 1W 5%	1
R405,406	36647	RESISTOR FIXED 33 OHM 1/4W 5%	2
R407,408	36826	RESISTOR FIXED .1 OHM 1W 5%	2
R409,411	36835	RESISTOR FIXED 22K 1/4W 5%	2
R410	36921	RESISTOR VARIABLE 20K 10%	1
R412	36832	RESISTOR FIXED 681K 1/4W 1%	1
R413	36656	RESISTOR FIXED 10K 1/4W 5%	1
Q400,401	36853	TRANSISTOR MOSFET IRF840	2
Q402	36964	TRANSISTOR 2N2222	1
T400	36850	TRANSFORMER INPUT	1
T401	36851	TRANSFORMER POWER	1
TH400,401	36836	THERMISTOR CL150	2

ASSOCIATED RESEARCH INC.	REPLACEMENT PART LIST		REVISION <u>E</u>
			ECO <u>4436</u>
	MODEL	SERIAL #	DATE 10-01-91
	5400DT	121 TO DATE	PAGE 10 OF 13
	5450DT	133 TO DATE	

<u>SYM</u>	<u>PART #</u>	<u>DESCRIPTION</u>	<u>QTY</u>
TP400	35644	TERMINAL STRIP ONE MALE HDR	1
U400	36691	IC 7815	1
U401	36691	IC 7815	1
U402	36916	IC OPTOCOPLER 4N15	1
	36713	BRACKET POWER AMPLIFIER	1
	36711	TRANSISTOR INSULATOR	2
	36813	TRANSISTOR TAPE INSULATING	1

5400DT-19 PCB ASST HV INTERFACE (5400DT ONLY)

D500	34933	DIODE SIL 1000PIV 1A 1N4007	1
J501	35665	CONNECTOR FEMALE 10 POS. DIP	1
K500	35433	RELAY SPST 5VDC 5A	1
P500-504,506	35510	TERMINAL TB CONNECTOR .187DB	6
P505	36710	HEADER PCB 10 POS. DIP	1
R500	36693	RESISTOR FIXED 10M 3.5W 1%	1
R501	35092	RESISTOR FIXED 10K 1/4W 1%	1
R502	36783	RESISTOR FIXED 10 OHM 1/4W 1%	1
C500	36673	CAPACITOR CERAMIC .1MF 50V	1

5450DT-19 PCB ASST HV INTERFACE (5450DT ONLY)

C500	36673	CAPACITOR CERAMIC .1MF 50V	1
C501	19616	CAPACITOR HV .25MF 5KV DC	1
D500,502,503,	34933	DIODE SIL 1000PIV 1A 1N4007	4
D504			
D501	36953	DIODE SILICON HV 15KV	1
J501	35665	CONNECTOR FEMALE 10 POS DIP	1
K500	35433	RELAY SPST 5V DC 5A	1
K503	36959	RELAY SPST NC HV	1
K501,502	36919	RELAY SPST NO HV	2
K504	36960	RELAY SPST NC HV	1
P505	36710	HEADER PCB 10 POS. DIP	1
P500-504,506,	35510	TERMINAL TB CONNECTOR .187 DB	6
P507			

ASSOCIATED RESEARCH INC.	REPLACEMENT PARTS LIST				REVISION	E
					ECO	4436
	MODEL	SERIAL #			DATE	10-01-91
	5400DT	121	TO	DATE	PAGE	11 OF 13
	5450DT	138	TO	DATE		

<u>SYM</u>	<u>PART #</u>	<u>DESCRIPTION</u>	<u>QTY</u>
Q501	34517	TRANSISTOR PNP TIP42	1
Q500	34516	TRANSISTOR NPN TIP41	1
R500	36690	RESISTOR FIXED 100 M OHM 3.5W 1%	1
R501,507	35092	RESISTOR FIXED 10K 1/4W 1%	2
R505	36828	RESISTOR FIXED 1.0K 1/4W 1%	1
R503	36968	RESISTOR FIXED 1M 10W 1%	1
R502	10904	RESISTOR FIXED 10 OHM 1/2W 1%	1
R504	36268	RESISTOR FIXED 5K 10W 1%	1
R508	36793	RESISTOR FIXED 100 OHMS 1/4W 1%	1
JU500	36010	CABLE 18AWG 1 CONDUCTOR WHITE	.500

5400DT-25 PCB ASSY REMOTE INTERFACE

C700-704,	36673	CAPACITOR .1 MFD 50V CERAMIC	33
C708-735			
C705,706,740,	36810	CAPACITOR 10MF 25V TANT 10%	4
C741			
C707	36801	CAPACITOR FILM .047UF 100V 10%	1
C736,737	18427	CAPACITOR ELECTROLYTIC 1MFD 50V RD	2
C738,739	36753	CAPACITOR ELECTROLYTIC 22MF 16VDC	2
D700,701	34513	DIODE 75V 10MA 1N4148	4
D703,704			
D702	36932	DIODE SIL ZENER 11V 1N4741A	1
J700	35798	CONNECTOR TRANSITION 26 CONT	1
J700	35777	CONNECTOR FEMALE 26 CONT RIBBON	1
J701	36770	HEADER PCB 10 POS. DIP	1
J701	35665	CONNECTOR FEMALE 10 POS. DIP	1
J702	36778	CONNECTOR 25 PIN SUB PCB MOUNTING	1
R700,701,704,	36758	RESISTOR VARIABLE 10K 1/4W	4
R706			
R702,705	36654	RESISTOR FIXED 5.1K 1/4W 5%	2
R703,707,712,	36650	RESISTOR FIXED 100 OHM 1/4W 5%	5
R715,716			
R708-711	36647	RESISTOR FIXED 33 OHM 1/4W 5%	4

ASSOCIATED RESEARCH INC.	REPLACEMENT PARTS LIST				REVISION <u> E </u>
					ECO <u> 4436 </u>
	<u>MODEL</u>	<u>SERIAL #</u>			DATE 10-01-91
	5400DT	121	TO	DATE	PAGE 12 OF 13
	5450DT	138	TO	DATE	

<u>SYM</u>	<u>PART #</u>	<u>DESCRIPTION</u>	<u>QTY</u>
R713,714	36656	RESISTOR FIXED 10K 1/4W 5%	2
R717	36666	RESISTOR FIXED 20K 1/4W 5%	1
RN700	36668	RESISTOR DIP PACK 1K TYPE 3	1
TP1-4	35644	TERMINAL STRIP ONE MALE HDR	4
U700,701	36738	IC QUAD OP AMP TL084ACN	2
U702	36931	IC VOLTAGE REGULATOR -5V	1
U703	36930	IC VOLTAGE REGULATOR +5V	1

5400DT-31 PCB ASSY GATE DRIVE

D412-417	34513	DIODE SIL 75PIV 10MA 1N4148	6
R419,423	18375	RESISTOR FIXED 1K 1/4W 5%	2
R420,424	35206	RESISTOR FIXED 220 OHM 1/4W 5%	2
R421,425	36825	RESISTOR FIXED 27K 1/4W 5%	2
R422,426	36795	RESISTOR FIXED 330 OHM 1/4W 5%	2
Q403,404	36964	TRANSISTOR NPN 2N2222	2
T402,403	05400DT-30	TRANSFORMER ASSY GATE DRIVE	2

5400DT-32 PCB ASSY ANALOG/PWM

C409,425	36917	CAPACITOR 270PF 100V 5%	2
C419,420,423,	36673	CAPACITOR .1MFD 50V CERAMIC	5
C426,427			
C421,424	36905	CAPACITOR FILM 1MF 50V	2
C422	36844	CAPACITOR FILM .001MF 50V	1
D418	36849	DIODE SIL ZENER 6.8V 1N476B	1
D419	35688	DIODE SIL ZENER 4.7V 1N5230B	1
R414	36833	RESISTOR FIXED 34K 1/4W 1%	1
R426	36834	RESISTOR FIXED 3.32K 1/4W 1%	1
R427	36832	RESISTOR FIXED 681K 1/4W 1%	1
R428,433,436,	36828	RESISTOR FIXED 1K 1/4W 1%	4
R437			
R429,432	36829	RESISTOR FIXED 1.2K 1/4W 5%	2
R430,434	36827	RESISTOR FIXED 5.11K 1/4W 1%	2
R431	35094	RESISTOR FIXED 15K 1/4W 1%	1

ASSOCIATED RESEARCH INC.	REPLACEMENT PARTS LIST				REVISION <u> E </u>
					ECO <u> 4436 </u>
	<u>MODEL</u>	<u>SERIAL #</u>			DATE 10-01-91
	5400DT	121	TO	DATE	PAGE 12 OF 13
	5450DT	138	TO	DATE	

<u>SYM</u>	<u>PART #</u>	<u>DESCRIPTION</u>	<u>QTY</u>
R713,714	36656	RESISTOR FIXED 10K 1/4W 5%	2
R717	36666	RESISTOR FIXED 20K 1/4W 5%	1
RN700	36668	RESISTOR DIP PACK 1K TYPE 3	1
TP1-4	35644	TERMINAL STRIP ONE MALE HDR	4
U700,701	36738	IC QUAD OP AMP TL084ACN	2
U702	36931	IC VOLTAGE REGULATOR -5V	1
U703	36930	IC VOLTAGE REGULATOR +5V	1

5400DT-31 PCB ASSY GATE DRIVE

D412-417	34513	DIODE SIL 75PIV 10MA 1N4148	6
R419,423	18375	RESISTOR FIXED 1K 1/4W 5%	2
R420,424	35206	RESISTOR FIXED 220 OHM 1/4W 5%	2
R421,425	36825	RESISTOR FIXED 27K 1/4W 5%	2
R422,426	36795	RESISTOR FIXED 330 OHM 1/4W 5%	2
Q403,404	36964	TRANSISTOR NPN 2N2222	2
T402,403	05400DT-30	TRANSFORMER ASSY GATE DRIVE	2

5400DT-32 PCB ASSY ANALOG/PWM

C409,425	36917	CAPACITOR 270PF 100V 5%	2
C419,420,423,	36673	CAPACITOR .1MFD 50V CERAMIC	5
C426,427			
C421,424	36905	CAPACITOR FILM 1MF 50V	2
C422	36844	CAPACITOR FILM .001MF 50V	1
D418	36849	DIODE SIL ZENER 6.8V 1N476B	1
D419	35688	DIODE SIL ZENER 4.7V 1N5230B	1
R414	36833	RESISTOR FIXED 34K 1/4W 1%	1
R426	36834	RESISTOR FIXED 3.32K 1/4W 1%	1
R427	36832	RESISTOR FIXED 681K 1/4W 1%	1
R428,433,436,	36828	RESISTOR FIXED 1K 1/4W 1%	4
R437			
R429,432	36829	RESISTOR FIXED 1.2K 1/4W 5%	2
R430,434	36827	RESISTOR FIXED 5.11K 1/4W 1%	2
R431	35094	RESISTOR FIXED 15K 1/4W 1%	1

ASSOCIATED RESEARCH INC.	REPLACEMENT PARTS LIST				REVISION	E
					ECO	4436
	MODEL	SERIAL #			DATE	10-01-91
	5400DT	121	TO	DATE	PAGE	13 OF 13
	5450DT	138	TO	DATE		

<u>SYM</u>	<u>PART #</u>	<u>DESCRIPTION</u>	<u>QTY</u>
R435	36830	RESISTOR FIXED 560 OHM 1/4W 5%	1
R438	35222	RESISTOR FIXED 680 OHM 1/4W 5%	1
R439	36795	RESISTOR FIXED 330 OHM 1/4W 5%	1
Q405	36964	TRANSISTOR NPN 2N2222	1
Q406	36852	TRANSISTOR PNP 2N2907	1
U403	36854	IC PWM SG3731	1
U404	36855	IC COMPARATOR LM311N	1
	36923	CONNECTOR MALE 7 POS. RT. ANGLE	1

ASSOCIATED RESEARCH INC.	REPLACEMENT PARTS LIST				REVISION <u>E</u>
					ECO <u>4436</u>
	<u>MODEL</u>	<u>SERIAL #</u>			DATE <u>10-01-91</u>
	5400DT	121	TO	DATE	PAGE <u>13</u> OF <u>13</u>
	5450DT	138	TO	DATE	

<u>SYM</u>	<u>PART #</u>	<u>DESCRIPTION</u>	<u>QTY</u>
R435	36830	RESISTOR FIXED 560 OHM 1/4W 5%	1
R438	35222	RESISTOR FIXED 680 OHM 1/4W 5%	1
R439	36795	RESISTOR FIXED 330 OHM 1/4W 5%	1
Q405	36964	TRANSISTOR NPN 2N2222	1
Q406	36852	TRANSISTOR PNP 2N2907	1
U403	36854	IC PWM SG3731	1
U404	36855	IC COMPARATOR LM311N	1
	36923	CONNECTOR MALE 7 POS. RT. ANGLE	1




GE Rental/Lease

Rental Accessory

Failure to return this item will
result in a minimum charge of **\$100⁰⁰**

1-800-GE-RENTS

GE-11

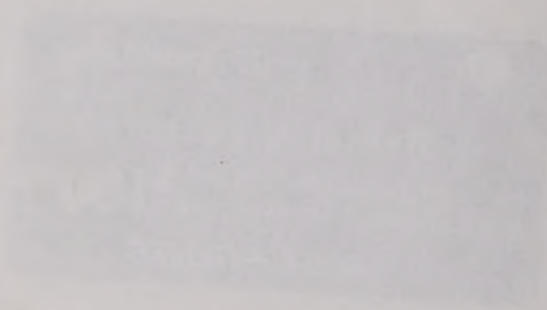

MP MASTER



MA30099